

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave.St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-022315**Date Inspected:** 16-Mar-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** An Qing Xiang**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG Components**Summary of Items Observed:**

On this day CALTRANS OSM Quality Assurance (QA) Inspector, Anand Upadhye was present during the times noted above for observations relative to the work being performed.

NDT

BAY 14

The following Non Destructive Testing (NDT) inspection carried out as per the ZPMC submitted notification number 08556.

Magnetic Particle Testing (MT).

This QA inspector performed MT of approximately 15 % of the area previously tested and accepted by ZPMC Quality control personnel. This QA inspector generated MT report for this date. The members are identified as OBG Components. The weld designations reviewed are as follows:

DP3162-001-235, 251, 254, 259, 262, 267, 270, 275, 278, 283, 191~200, 423, 426, 212.

DP3162-001-213, 220, 221, 228, 229, 236, 237, 252, 253, 260, 261, 268, 269, 276, 277.

DP3162-001-284, 285, 021, 022, 211, 214, 219, 222, 227, 230.

WELDING

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

This QA Inspector observed the following work in progress:

BAY 14

This QA Inspector observed ZPMC qualified welding personnel identified as 067707 perform welding by Shielded Metal Arc Welding (SMAW), on Deck panel diaphragm to deck panel deck panel diaphragm weld of OBG Segment 13BW. Weld joint is identified as SEG3014G-001. ZPMC Quality Control (QC) Inspector identified as Zhang Lin was present to monitor the welding process. The welding variables recorded by ZPMC QC appeared to be in general compliance with WPS-B-P-2213-B-U2-FCM-1. This QA Inspector noted welding variables were 130~145 amperes and 24.6 volts, which appears to be in compliance with the approved WPS. See attached picture.

This QA Inspector observed ZPMC qualified welding personnel identified as 066261 perform welding by Shielded Metal Arc Welding (SMAW), on Deck panel to Corner assembly deck plate weld of OBG Segment 13BW. Weld joint is identified as SEG3014-009. ZPMC Quality Control (QC) Inspector identified as Zhang Lin was present to monitor the welding process. The welding variables recorded by ZPMC QC appeared to be in general compliance with WPS-B-P-2214-B-U2-FCM-1. This QA Inspector noted welding variables were 145~160 amperes and 25.4 volts, which appears to be in compliance with the approved WPS.

This QA Inspector observed ZPMC qualified welding personnel identified as 067764 perform welding by Shielded Metal Arc Welding (SMAW), on Corner assembly edge plate to Corner assembly edge plate weld of OBG Segment 13BW and 13CW. Weld joint is identified as OBW13A-018. ZPMC Quality Control (QC) Inspector identified as Zhang Lin was present to monitor the welding process. The welding variables recorded by ZPMC QC appeared to be in general compliance with WPS-B-P-2213-B-U2-FCM-1. This QA Inspector noted welding variables were 125~135 amperes and 24.1 volts, which appears to be in compliance with the approved WPS.

This QA Inspector observed ZPMC qualified welding personnel identified as 045143 perform welding by Flux Cored Arc Welding (FCAW), on floor beam to floor beam weld of OBG Segment 13CW. Weld joint is identified as SEG3015G-154, 155. ZPMC Quality Control (QC) Inspector identified as Wang Xiang Pin was present to monitor the welding process. The welding variables recorded by ZPMC QC appeared to be in general compliance with WPS-B-T-2231-ESAB. This QA Inspector noted welding variables were 295~305 amperes and 25.2 volts, which appears to be in compliance with the approved WPS.

This QA Inspector observed ZPMC qualified welding personnel identified as 066443 perform welding by Shielded Metal Arc Welding (SMAW), on Deck panel diaphragm to deck panel deck panel diaphragm weld of OBG Segment 13BW. Weld joint is identified as SEG3014J-012. ZPMC Quality Control (QC) Inspector identified as Wang Xiang Pin was present to monitor the welding process. The welding variables recorded by ZPMC QC appeared to be in general compliance with WPS-B-P-2213-B-U2-FCM-1. This QA Inspector noted welding variables were 145~155 amperes and 25 volts, which appears to be in compliance with the approved WPS.

This QA Inspector observed ZPMC qualified welding personnel identified as 045143 perform welding by Flux Cored Arc Welding (FCAW), on floor beam to floor beam weld of OBG Segment 13CW. Weld joint is identified as SEG3015E-014. ZPMC Quality Control (QC) Inspector identified as Wang Xiang Pin was present to monitor the welding process. The welding variables recorded by ZPMC QC appeared to be in general compliance with WPS-B-T-2233-ESAB. This QA Inspector noted welding variables were 230~245 amperes and 25.3 volts, which appears to be in compliance with the approved WPS. See attached picture.


WELDING INSPECTION REPORT

(Continued Page 3 of 3)

This QA Inspector observed ZPMC qualified welding personnel identified as 066361, 069683 perform welding by Shielded Metal Arc Welding (SMAW), on Deck panel DP3148 to Deck panel DP3149 weld of OBG Segment 13CW. Weld joint is identified as SEG3015-001. ZPMC Quality Control (QC) Inspector identified as Shen Jian Bo was present to monitor the welding process. The welding variables recorded by ZPMC QC appeared to be in general compliance with WPS-B-P-2214-B-U2-FCM-1. This QA Inspector noted welding variables were 120~140 amperes and 25.7 volts, which appears to be in compliance with the approved WPS.

This QA Inspector observed ZPMC qualified welding personnel identified as 045196 perform welding by Shielded Metal Arc Welding (SMAW), on Deck panel diaphragm to deck panel I-rib stiffener weld of OBG Segment 13BW. Weld joint is identified as DP3135-001-019. ZPMC Quality Control (QC) Inspector identified as Shen Jian Bo was present to monitor the welding process. The welding variables recorded by ZPMC QC appeared to be in general compliance with WPS-B-P-2213-Tc-U4b-FCM-1. This QA Inspector noted welding variables were 135~150 amperes and 24.4 volts, which appears to be in compliance with the approved WPS.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

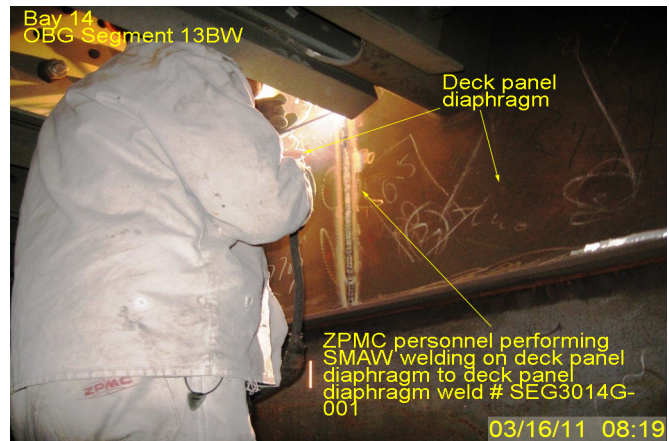

Summary of Conversations:

No significant conversations were reported on this date.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang, phone: 15000422372 , who represents the Office of Structural Materials for your project.

Inspected By: Upadhye, Anand

Quality Assurance Inspector

Reviewed By: Clifford, William

QA Reviewer